SRB CRITICAL ITEMS LIST

SUBSYSTEM: RANGE SAFETY COMMAND DESTRUCT

ITEM NAME: Safe and Arm Assembly

PART NO.: 10311-0003-801 FM CODE: A08

CH MS

ITEM CODE: 70-13 REVISION: Basic

CRITICALITY CATEGORY: 1R REACTION TIME: Immediate

NO. REQUIRED: 1 DATE: March 31, 1999

CRITICAL PHASES: Boost SUPERCEDES: March 31, 1998

PMEA PAGE NO.; F-48 ANALYST: S. Roney/ K. C. Finch

SHEET 1 OF 4 APPROVED: P. Kalia

FAILURE MODE AND CAUSES: PETN explosive leads (both) fail to propagate the detonation train caused by:

Insensitive explosive degraded by moisture, contamination or chemical decomposition

- Voids or cracks in the leads
- Improper gap at external interface
- Contamination or excessive gaps at internal interfaces
- Overheating of charge
- Insufficient charge
- Vibration/shock

FAILURE EFFECT SUMMARY: Loss of the ability to detonate the destruct ordnance may result in loss of life or injury to the public in the case of an abort during the boost phase. One success path remains after the first failure. Operation is not affected until both paths are lost.

REDUNDANCY SCREENS AND MEASUREMENTS:

- N/A
- N/A
- 3) Fail Contamination

RATIONALE FOR RETENTION:

- A. DESIGN
- O Design specification USBI 10SPC-0230
 - o Contamination control per paragraphs 3.1.2. (Contamination)

CN 035

ÇN 033

CN 035

CN 035

Date: March 31, 1999 FM Code: 70-13-A08

- Vibration levels per paragraph 3.4.1.2. (Cracks, Voids, Gaps)
- Shock levels per paragraph 3.4.1.3 (Cracks, Voids, Gaps)
- Explosive material (PETN) certified to MIL-P-387. (Contamination)
- O Predicted temperature will not exceed 106°F per SRB Thermal Design Data Book SE-019-068-2H, Table 4.9.1.1. (Overheating)
- O Explosive lead dimensions and internal interface/gap controlled dimensionally by SDI drawing 106521 (Excessive Gaps)

CN 035

Moisture content and core loading controlled by SDI drawing 106521. (Insensitive explosive)

CIN III35

O PETN charges on each end of lead controlled by SDI drawing 106521. (Contamination)

CEN DES

- Qualification
 - S&A Assembly 10311-0003-801 is qualified per SDI QTR107190- 2022 (Connector) and SDI RPT-106521 VolumeI-IV (Includes (NTS) Test Report 8971 (CC-16837-14) Volumes I-IV. (COQ A-PYR-6135-1). (1 Mission - SRB) CN 035

CIN USS

- Oualification Test
 - Thermal shock
 - Vibration.
 - Shock
 - High temperature (+165°F) Function (All Failure Causes)
 - Low temperature (+20°F) Function (All Failure Causes)

B. TESTING

O Lot acceptance test per SDI Procedure ATP 106521.

CN 034

- X-ray inspection of entire lot. (Gaps, voids, cracks) N-ray inspection of entire lot. (Gaps, voids, cracks)
- Vibration test of entire lot. (Vibration)
- Helium leak test of entire (ot. (Contamination)
- Ambient function test in the armed position of five percent of the lot. (All Failure Causes)
- Temperature/humidity test of ten percent of the lot.
- Vibration test of ten percent of lot. (Vibration)
- O Explosive lead lot acceptance test are conducted in accordance with SDI procedure ATP 106521 and include the following: CN 035

DR Document: RA-21 Supercedes: March 31, 1998

FM Code: 70-13-A08 Date: March 31, 1999

- o Leak test of entire lot. (Contamination)
- o N-ray inspection of entire lot. (Gaps, voids, cracks)
- o Ambient function test of ten percent of lot. (All Failure Causes)

KSC TESTING

- S&A preinstallation testing per OMRSD File V, Vol. 1, Req. B000FL.004.
- C. INSPECTION

VENDOR RELATED INSPECTIONS

- O Receiving inspection: All explosive material certifications and test reports are verified by USBI Quality Assurance and contractor Quality Assurance per: (Contamination, insensitive explosive)
 - USBI Quality Assurance
 - USBI SIP 1485
 - Contractor Quality Assurance
 - SDI Manufacturing and Inspection Plan/Drawing T106521.

CNOX

- PETN explosive lead acceptance test, N-Ray film is inspected by certified vendor personnel and verified by USBI personnel. Ambient function test is witnessed one hundred percent by USBI Quality Assurance and contractor Quality Assurance per: (All Failure Causes)
 - USBI Quality Assurance
 - USBI SIP 1485
 - o Contractor Quality Assurance
 - SDI ATP 106521

CH 635

- O Assembly operation: Moisture content determination, mass ratio, explosive loading and sealing process are verified one hundred percent by Contractor Quality Assurance and USBI Quality Assurance per: (Contamination)
 - USBI Quality Assurance
 - USBI SIP 1485

Supercedes: March 31, 1998 DR Document: RA-21

FM Code:		70-13-A08	Date: March 31, 1999	
	o Con	nuactor Quality Assurance		
	-	SDI Manufacturing and Inspection Plan/Drawing T106521	CN 035	
O Lot acceptance test: N-Ray and X-Ray films are inspected by certified vendor personnel and personnel. Vibration test is monitored by USBI Quality Assurance and witnessed by Contrac Assurance one hundred percent. Leak test and ambient temperature test are witnessed one hu USBI Quality Assurance and Contractor Quality Assurance per: (All Failure Causes)		Contractor Quanty d one hundred percent by		
	o USI	BI Quality Assurance		
	-	USBI SIP 1485		
	o Con	tractor Quality Assurance		
	-	SDI ATP 106521-	CN 035	
0	Lot revie	ew and certification per USBI Plan 10PLN-0049	CN 035	
0	Critical 1	Processes/Inspections/Operations:		
The following critical process/inspections/operations are used to assure that explosive charge i		e charge is properly sealed.		
		tay per SD1 ATP 106521.		
	o Heli	lay per SDI ATP 106521. ium leak test per SDI ATP106521.		
	o Adh	nesive application to PETN explosive leads per SDI ATP 106521.	CN 083	
	KSC RELATED INSPECTION		CN 035	
O	S&A de	vice is inspected per OMRSD File V, Vol. 1, Req. B000FL.004.		
_	EATI (TE	RE HISTORY	CN 035	
_				
O	ranure)	Histories may be obtained from the PRACA database.		
E.	OPERA	TIONAL USE		
D	Not app	licable to this failure mode.		

Supercedes: March 31, 1998 DR Document: RA-21

70 - 124